

AV98A161

CONNECTION TECHNOLOGY • CABLE SOCKETS / CONNECTORS PRE-ASSEMBLED ON TWO SIDES

accessories, , Suitable for self-assembly, 3m, M8 Female (socket) 3pin Straight, Mini Male (plug) 3pin Straight, 3x0.34mm², PUR (Polyurethane), Suitable for trailing chain and torsion resistant, Oil and cooling lubricants, Welding area, Silicone-free



MECHANICAL FEATURES

Cable infeed of A connection	Straight
Cable infeed of B connection	Straight
Cable length	3 m
Material of cable sheath	PUR (Polyurethane)
Number of cores	3
Torsion cycles	+/-360°/m, ≥ 2 million cycles
Trailing chain cycles	5 million cycles
Version	Connection cable
Wire cross section	0.34 mm ²

ELECTRICAL FEATURES

Number of pins of A connection	3
Number of pins of B connection	3
Suitable for self-assembly	+
Type of A electrical connection	M8
Type of B electrical connection	Mini
Type of plug-in contact, A connection	Female (socket)
Type of plug-in contact, B connection	Male (plug)

OTHER FEATURES

Flame retardant	In accordance with EN 60332-2-2
Free of LABS	+
Halogen-free	+
Hydrolysis-proof	+
IR-networked	-
Oil and cooling lubricants	+
Ozone and UV-resistant	+
Silicone-free	+
Suitable for trailing chain and torsion resistant	+
Welding area	+


Other

Packaging dimensions	175.0mm x 15.0mm x 175.0mm
Shipping weight	0.08kg
Tariff code	85444290

Classification

ipf product group	700
eClass 8.0	27279218
eClass 9.0	27060311
eClass 9.1	27060311
ETIM-5.0	EC001855
ETIM-6.0	EC001855
ETIM-7.0	EC001855

Connection

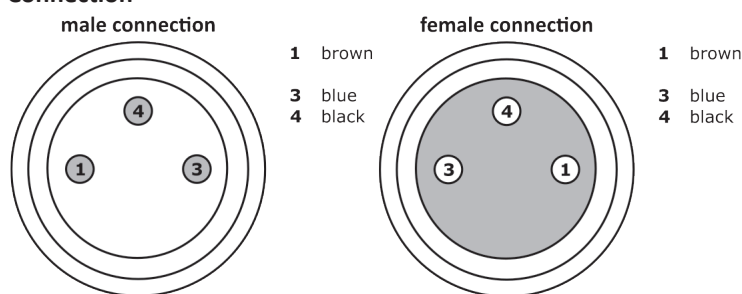

Dimensional drawing

Installation



Mounting / installation may only be carried out by a qualified electrician!

Disposal



Safety warnings

Before initial operation, please make sure to follow all safety instructions that may be provided in the product information. Never use these devices in applications where the safety of a person depends on their functionality. LED lighting systems can generate intensive UV radiation, which can damage your eyes in case of improper use. The manufacturer cannot be held responsible for damages that result from improper use or connection.